



Excerpts from AMSAA's M109A6 Paladin Starter Motor Corrosion Analysis

For the 2010
U.S. Army Corrosion Summit
February 9-11, 2010

**Approved for Public Release
Distribution is Unlimited**

Brian E. Frymiare
U.S. Army Materiel
Systems Analysis Activity

Report Documentation Page				Form Approved OMB No. 0704-0188	
Public reporting burden for the collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington VA 22202-4302. Respondents should be aware that notwithstanding any other provision of law, no person shall be subject to a penalty for failing to comply with a collection of information if it does not display a currently valid OMB control number.					
1. REPORT DATE FEB 2010		2. REPORT TYPE		3. DATES COVERED 00-00-2010 to 00-00-2010	
4. TITLE AND SUBTITLE Excerpts from AMSAA's M109A6 Paladin Starter Motor Corrosion Analysis				5a. CONTRACT NUMBER	
				5b. GRANT NUMBER	
				5c. PROGRAM ELEMENT NUMBER	
6. AUTHOR(S)				5d. PROJECT NUMBER	
				5e. TASK NUMBER	
				5f. WORK UNIT NUMBER	
7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES) U.S. Army Materiel Systems Analysis Activity,AMSRD-AMS-LR,392 Hopkins Rd, Bld 248,Aberdeen Proving Ground,MD,21005				8. PERFORMING ORGANIZATION REPORT NUMBER	
9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES)				10. SPONSOR/MONITOR'S ACRONYM(S)	
				11. SPONSOR/MONITOR'S REPORT NUMBER(S)	
12. DISTRIBUTION/AVAILABILITY STATEMENT Approved for public release; distribution unlimited					
13. SUPPLEMENTARY NOTES 2010 U.S. Army Corrosion Summit, Huntsville, AL, 9-11 Feb					
14. ABSTRACT					
15. SUBJECT TERMS					
16. SECURITY CLASSIFICATION OF:			17. LIMITATION OF ABSTRACT Same as Report (SAR)	18. NUMBER OF PAGES 13	19a. NAME OF RESPONSIBLE PERSON
a. REPORT unclassified	b. ABSTRACT unclassified	c. THIS PAGE unclassified			



Agenda

- What's a M109A6 Paladin?
- What's a Starter?
- Background
- Failed M109A6 Starter
- Analysis
- Analysis Results
- Recommendations
- Alternate Test Procedure
- Questions

**"It is a capital mistake to theorize
before you have all the evidence.
It biases the judgment."**

Sir Arthur Conan Doyle 1859 - 1930



What's a M109A6 Paladin?





What's a Starter?





Background

An Unusually High Rate of M109A6 Paladin Starter Motors were Failing

The Failure Mode was Excessive Corrosion

The Corrosion Rendered the Starters Inoperative

Problem Started after a Switch from the Original Manufacturer to a New Manufacturer



Failed M109A6 Starter



**Starter Drive Gear
And Armature Shaft
Corroded Together
Unserviceable**



Two Starter Motors (One from Each Manufacturer) were Analyzed.

A **Thorough** Material Analysis was Conducted on the Starters





Analysis Results

Despite the New Manufacturer stating that their Starter Motor Shaft's Utilized a Protective Zinc Plating, **NO** Zinc was Found on the Armature Shaft Analyzed.

Lack of a Protective Coating Undoubtedly Led to the High Rate of Starter Motor Failures

The Corrosion Problem **WAS NOT** Revealed Under the Required 96 Hour Salt Spray Test

Corrosion was Starting on the Original Starter, Where the Starter Drive Gear Slides on the Armature Shaft – Wearing the Protective Zinc Coating Off



Recommendations



Three areas of recommendations were made:

Recommendations for the Current Starter

Recommendations for Future Starter

Recommendations Regarding Future Salt Water Spray Testing.

“In any situation,

The best thing you can do is the right thing.
The next best thing you can do is the wrong thing.
The worst thing you can do is nothing.”

Theodore (Teddy) Roosevelt
26 th President of the United States



Recommendations (Cont)


It was Recommended that any New Existing Starter Motors not be Utilized, and Starters Already Utilized be Recalled and Destroyed

That for Future Starters, the Starter Armatures Material be Changed to Stainless Steel (Commercial Practice)

It was Recommended that all Starter Motors be Exercised During Salt Water Spray Corrosion Testing, and the Test Procedure be Changed so that any Similar Items be Exercised During Salt Water Spray Corrosion Testing



Failed M109A6 Starter

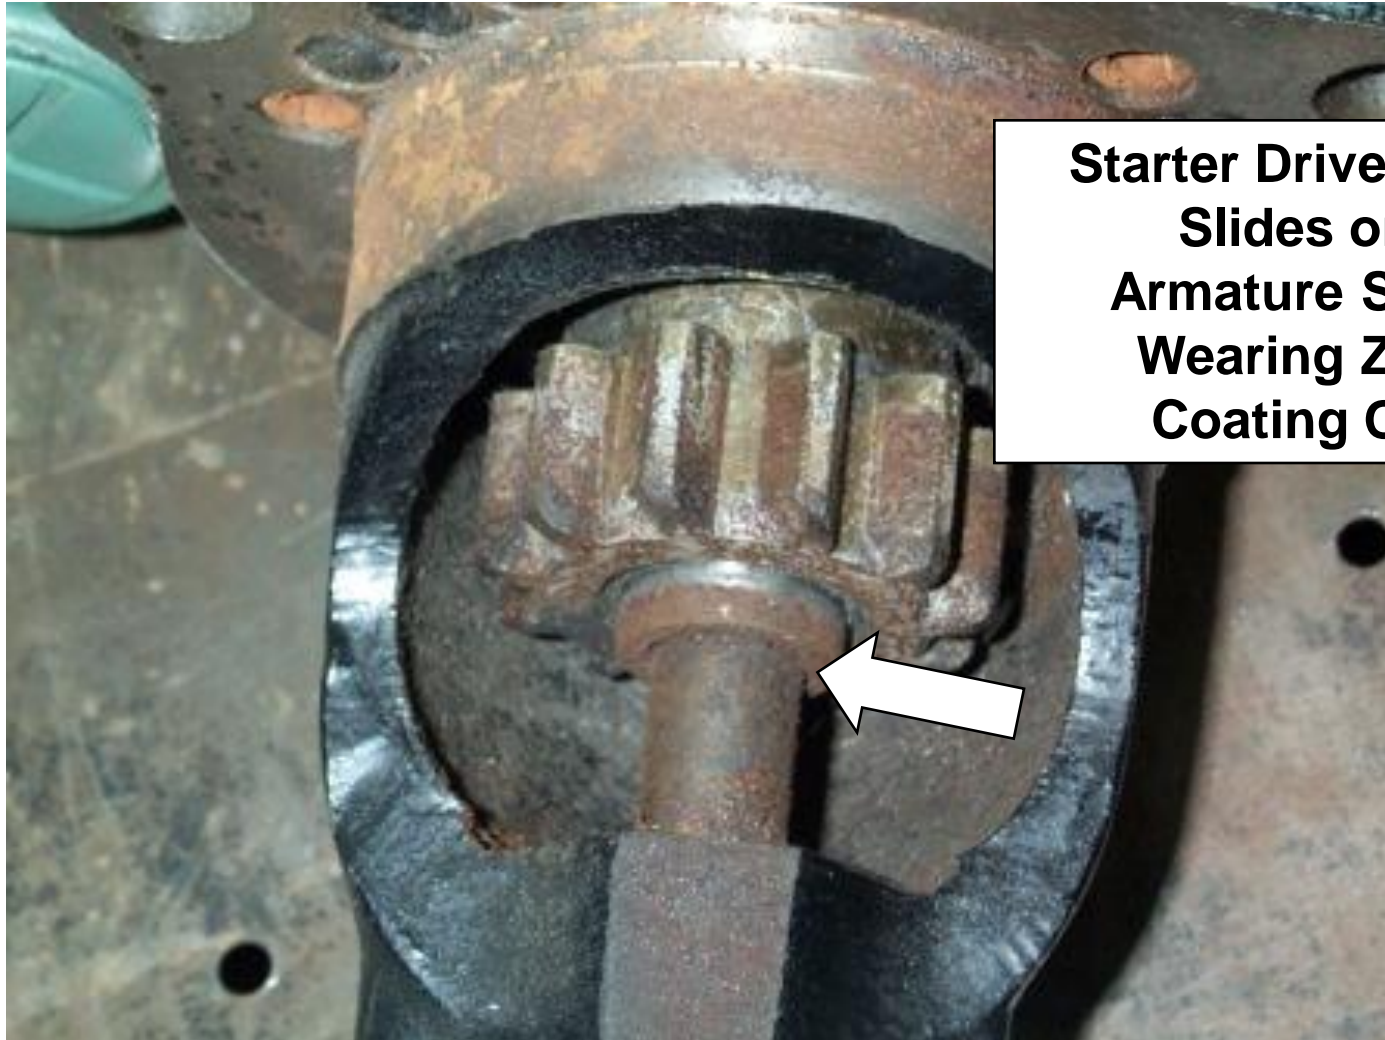

**Starter Drive Gear
Slides on
Armature Shaft
Wearing Zinc
Coating Off**



Proposed Alternate Test Procedure

- Conduct 24 Hours of Salt Spray Testing
- Utilize Test Item for 40 % of its Life Cycle
- Conduct an Additional 24 Hours of Salt Spray Testing
- Utilize Test Item for an Additional 40 % of its Life Cycle
- Conduct an Additional 48 Hours of Salt Spray Testing

Above Test Procedure Should Reveal Corrosion on Parts
That Wear

Other Procedures May be More Viable, or Cost Effective



Questions????

And Hopefully Some Good Answers !